



# Tech Info Library

## Communications Interface Card: Manual Errata (11/96)

Revised: 11/21/96  
Security: Everyone

Communications Interface Card: Manual Errata (11/96)

=====

Article Created: 19 May 1985  
Article Reviewed/Updated: 18 November 1996

TOPIC -----

Listed below are corrections to the Communications Interface card manual  
030-0008-01.

DISCUSSION -----

Corrections  
=====

Page 17

-----

The lower case info only applies to TERMINAL modes and the method to use it is not obvious. Also, the POKE 1784+n,160 causes the lower case to be displayed as FLASHING. POKE 1784+n,224 will cause lower case to be INVERSE.

Page 24

-----

DATAMOVER will not work with Applesoft. It will require a complete re-write of the program.

Page 28

-----

The Communications Card Print Routine was written when the only available DOS was version 3.1. POKE 845,110 will fix it to work with DOS 3.2 or DOS 3.3.

Page 36

-----

The modification for 4800 baud in the manual is missing a wire. Add a wire from pin 15 of A1 to pin 15 of A2. Chip A1 is still not required.

Article Change History:

18 Nov 1996 - Reviewed for technical accuracy, revised formatting.

Copyright 1985-96. Apple Computer, Inc.

Tech Info Library Article Number:1138