



# Tech Info Library

## Macintosh Plus :Developer's Sw. Can Cause Resets

Revised: 4/6/93  
Security: Everyone

Macintosh Plus :Developer's Sw. Can Cause Resets

=====

Article Created: 27 September 1985  
Article Last Reviewed: 17 July 1992  
Article Last Updated:

PROBLEM DESCRIPTION: When the developer's switch is installed on the Macintosh Plus, sometimes it will reset spontaneously.

CAUSE: Insufficient clearance between the developer's switch and logic switch on the power/sweep board.

CURE: 1. Remove the developer's switch to determine if it was the cause.  
2. If the machine stops resetting spontaneously, file down the developer's switch approximately 1/16 to 1/8 of an inch.  
3. Replace the developer's switch onto the machine.

Copyright 1988 Apple Computer, Inc.

Tech Info Library Article Number:1691