



Tech Info Library

LaserWriter II: Black Printout Problem Cure

Revised: 1/17/89
Security: Everyone

LaserWriter II: Black Printout Problem Cure

=====

This article last reviewed: 5 January 1989

Problem: The printout from the LaserWriter II is black except for the top which may consist of 5 thin white lines 1 to 1.5 inches apart. There is also excess toner spilled around the corona wire assembly. This may occur after the corona assembly or the transfer guide assembly has been removed and replaced.

Cure: There is a brass colored grounding tab on one side of the transfer guide assembly, (if you are facing the printer from the paper tray end it's on the left side of the corona assembly) that should be in contact with the grounding spring on that side of the corona assembly. The tab pivots and can be in the wrong position when the corona assembly or transfer guide is removed and reinstalled.

Copyright 1988 Apple Computer, Inc.

Tech Info Library Article Number:3460