



Tech Info Library

LaserWriter IINT/IINTX: Symptoms of Badly Mounted Power Supply

Revised: 8/8/91
Security: Everyone

LaserWriter IINT/IINTX: Symptoms of Badly Mounted Power Supply

=====

Article Created: 15 April 1991
Article Last Reviewed:
Article Last Updated:

TOPIC -----

On power up, the LaserWriter IINT/NTX Ready light blinks, then the Toner light comes on solid. Shortly after this, both the Ready and Toner lights go solid, and the printer fails to generate a user self-test page. Subsequent service self-tests generate only blank pages.

DISCUSSION -----

These symptoms appear when the high-voltage power supply is incorrectly mounted with connector pins (to the DC Controller) completely missing their places. This only happens during a repair, when the high-voltage power supply is replaced.

Copyright 1991 Apple Computer, Inc.

Tech Info Library Article Number:7539