



Tech Info Library

AppleShare Client for Windows & Intel Ethernet Pro Card (8/95)

Revised: 8/7/95
Security: Everyone

AppleShare Client for Windows & Intel Ethernet Pro Card (8/95)

=====

Article Created: 7 August 1995

TOPIC -----

This article describes an installer Problem on PCs which have the Intel Ethernet Pro Card.

DISCUSSION -----

During the installation process, if the workstation has an Intel Ethernet Pro network interface card, the installer omits a necessary parameter for the AARP protocol. This necessary parameter is the network number. Manually edit the NET.CFG file and insert the 80F3 address as follows:

The affected line reads:

PROTOCOL AARP ETHERNET_SNAP

It should read:

PROTOCOL AARP 80F3 ETHERNET_SNAP

Support Information Services

Copyright 1995, Apple Computer, Inc.

Tech Info Library Article Number:18309